






축전지 점검결과

점검일	2023. 01. 11	점검형태	화재예방점검
업체명	건국대병원	온도(°c)	23.4
담당자/연락처	전기실 / 02-2030-7284	충전전압(V)	측정불가
용도,장소	B4층, 병동출입통제 자동문 UPS용	AC(A) / DC(A)	0/0
제품명	ESP100H+	내부저항(mΩ) 기준(참고)	
수량(EA)	16EA	점검결과	자체관리-유지,관리 미흡 기존 MSB전지를 리튬전지로 교체 운용중
LOT	2022.06.24		
셀	전압(V)	내부저항(mΩ)	비고
1	13.33	3.99	#DIV/0!
2	13.32	3.88	#DIV/0!
3	13.42	4.24	#DIV/0!
4	13.31	3.83	#DIV/0!
5	13.33	4.09	#DIV/0!
6	13.44	3.96	#DIV/0!
7	13.36	3.9	#DIV/0!
8	13.36	4.04	#DIV/0!
평균	13.36	3.991	#DIV/0!
설치업체 / 일자	2022.7.21	설치상태(배열,극성,체결상태)	
점검내용	5년교체주기	제품 외관상태(누액,파손여부등)	
		마킹 실시여부	有
운영환경	설치공간협소-측정불가	취급설명서 유무	無
		기타	
설치 장소		Lot/배열/극성	
볼트체결 /마킹유무		취급설명서 부착 유무	
기타 (전지상태, 환경등)			

리튬전지설치운용중



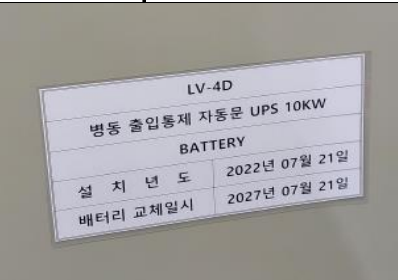